

YOUR ONESURVEY
HOME REPORT

ADDRESS

26 Bow Butts
Crail, Anstruther
KY10 3UR

PREPARED FOR

Karen Reekie

INSPECTION CARRIED OUT BY:



ALLIED
SURVEYORS
SCOTLAND

SELLING AGENT:



HOME REPORT GENERATED BY:

oneSURVEY | 
HOME REPORT

Document Index

Document	Status	Prepared By	Prepared On
Index of Documents			
<u>Single Survey</u>	Final	St Andrews - Allied Surveyors Scotland Plc	22/12/2023
<u>Mortgage Certificate</u>	Final	St Andrews - Allied Surveyors Scotland Plc	22/12/2023
<u>Property Questionnaire</u>	Final	Mrs. Karen Reekie	05/09/2023
<u>EPC</u>	Final	St Andrews - Allied Surveyors Scotland Plc	06/09/2023

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you visit www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	J3764
---------------------------	-------

Customer	Mrs. Karen Reekie
-----------------	-------------------

Selling address	26 Bow Butts Crail, Anstruther KY10 3UR
------------------------	---

Date of Re-inspection	22/12/2023
------------------------------	------------

Date of Original Inspection	05/09/2023
------------------------------------	------------

Prepared by	Mark Smith, Bsc MRICS St Andrews - Allied Surveyors Scotland Plc
--------------------	---

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

2 Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a two storey detached house.
Accommodation	GROUND FLOOR Entrance Hall, Lounge/Dining Area and Kitchen. FIRST FLOOR Landing, Three Bedrooms and Bathroom with WC.
Gross internal floor area (m2)	88 m2
Neighbourhood and location	The subjects form part of a private residential development on the north western periphery of Crail. The immediate surrounding properties are of similar age and construction. There are open aspect views to the rear, over a park/playing field. Adequate secondary shopping, educational, public transport and social facilities are available locally.
Age	Built around 1970/1975.
Weather	Dry, although dull/overcast. The report should be read in this context.
Chimney stacks	None.
Roofing including roof space	The roof is constructed of timber, pitched and laid in tiles, incorporating tiled ridging. A hatch to the landing ceiling allows access to the roof space. This area is insulated at joist level and part boarded/floored for storage.

	<p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</p>
Rainwater fittings	<p>The rainwater fittings are of PVC.</p> <p>Visually inspected with the aid of binoculars where required.</p>
Main walls	<p>The main walls are of cavity concrete block/brick construction, rendered externally, with the front elevation also incorporating some facing brick finishes. The walls are plastered on the hard internally.</p> <p>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</p>
Windows, external doors and joinery	<p>The windows are of uPVC double glazed styles.</p> <p>The front entrance door is of a moulded timber style with double glazed side screen. The rear entrance door is of a composite panel/glazed style.</p> <p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible. Doors and windows were not forced open.</p>
External decorations	<p>The external decorations are of paint or preservative.</p> <p>Visually inspected.</p>
Conservatories / porches	<p>None.</p>

<p>Communal areas</p>	<p>None.</p>
<p>Garages and permanent outbuildings</p>	<p>Attached to the left side elevation of the dwelling by means of a link wall/archway, is a single garage. The garage is of brick wall construction, rendered externally. The roof is flat and laid in mineral felt. The garage incorporates a manual metal up and over vehicular access door, and a timber pedestrian access door. There is a concrete screed floor. Lighting and power are installed.</p> <p>Attached to the rear of the garage is a store of concrete block wall construction, rendered externally, with the roof also being flat and laid in mineral felt. Access is via a timber door. There is also a timber casement single glazed window formation to the rear elevation. There is a concrete screed floor. Lighting and power are installed.</p> <p>Visually inspected.</p>
<p>Outside areas and boundaries</p>	<p>The front garden is slightly sloping in nature and is laid to lawn, incorporating well stocked borders and a paving slab footpath. A paving slab and stone chip driveway leads to the aforementioned garage. There is pedestrian access to the rear garden via the archway, between the dwelling and garage. The rear garden is laid to lawn, incorporating well stocked borders, as well as paving slab footpaths and a patio area. The site boundaries at the front are generally open plan in nature. The site boundaries to the rear are defined by timber fences. There is a park/playing field located beyond the rear most site boundary.</p> <p>Visually inspected.</p>
<p>Ceilings</p>	<p>The ceilings are of plasterboard.</p> <p>Visually inspected from floor level.</p>
<p>Internal walls</p>	<p>The internal walls appear to be of timber stud/plasterboard.</p> <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p>
<p>Floors including sub floors</p>	<p>The floor are of suspended timber construction.</p> <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access</p>


	<p>point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p>
Internal joinery and kitchen fittings	<p>The internal doors are of plain/flush timber styles, although the door to the lounge also incorporates recessed glazed panels. There is currently no door to the kitchen. The door facings and the skirting boards are of plain timber styles. A timber staircase with timber bannister, leads from the entrance hall to the upper level accommodation.</p> <p>The kitchen fittings comprise floor standing and wall mounted units.</p> <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p>
Chimney breasts and fireplaces	<p>None.</p>
Internal decorations	<p>The ceilings are finished with paint. The walls are mainly finished with paint, although the kitchen and the bathroom are part tiled. The internal joinery is finished with preservative.</p> <p>Visually inspected.</p>
Cellars	<p>None.</p>
Electricity	<p>Mains supply. The meter is located within an external box against the front elevation. The fuse box is boxed within the entrance hall.</p> <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
Gas	<p>Mains supply. The meter is located within a storage cupboard to the entrance hall.</p> <p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried</p>

	<p>out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
<p>Water, plumbing and bathroom fittings</p>	<p>Mains supply. Pipework (where seen) was noted to be of copper and PVC. There are enamel bowl and drainer sink units to the kitchen fittings.</p> <p>There is a polystyrene insulated fibreglass cold water storage tank within the roof space.</p> <p>There is a coloured bathroom suite, comprising bath, wash hand basin and WC.</p> <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.</p> <p>Concealed areas around baths and shower trays cannot be inspected however water spillage over a period of time can result in unexpected defects to hidden parts of the building fabric.</p>
<p>Heating and hot water</p>	<p>There is a gas fired central heating system, which also provides hot water. There is a Worcester Greenstar system boiler wall mounted under the stairs, within a storage cupboard to the entrance hall. The flue projects through an external wall to the outside, where it is protected by a metal guard. The programmer for the system is located within the hall cupboard, and there is a room thermostat to the hall itself.</p> <p>A hot water storage tank, incorporating foam insulation, is located within wardrobe/cupboard space to the left rear bedroom. The tank is fitted with a thermostat and an electric immersion heater.</p> <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.</p>
<p>Drainage</p>	<p>Drainage is to the mains sewer.</p> <p>Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.</p>
<p>Fire, smoke and burglar</p>	<p>Smoke alarms are installed.</p>

<p>alarms</p>	<p>Visually inspected. No test whatsoever were carried out to any systems or appliances.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>
<p>Any additional limits to inspection</p>	<p>Our inspection of the roof space was restricted by the presence of insulation materilas.</p> <p>The windows were tested at random.</p> <p>Due to fitted floor coverings and furnishings, no detailed inspection was possible of the floors and accordingly, we cannot comment further on their condition. No readily accessible hatches or loose floorboards were available to allow access to any sub-floor areas.</p> <p>The systems and the services were not tested.</p> <p>Our inspections of the garage and the store were restricted by a large degree of stored items.</p> <p>It is out with the scope of this inspection to determine whether or not asbestos based products are present within the property. Asbestos was widely used in the building industry until around 1999, when it became a banned substance. If you have any concerns, you should engage the services of a qualified asbestos surveyor.</p>

	<p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p> <p>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</p>
--	---

Sectional Diagram showing elements of a typical house

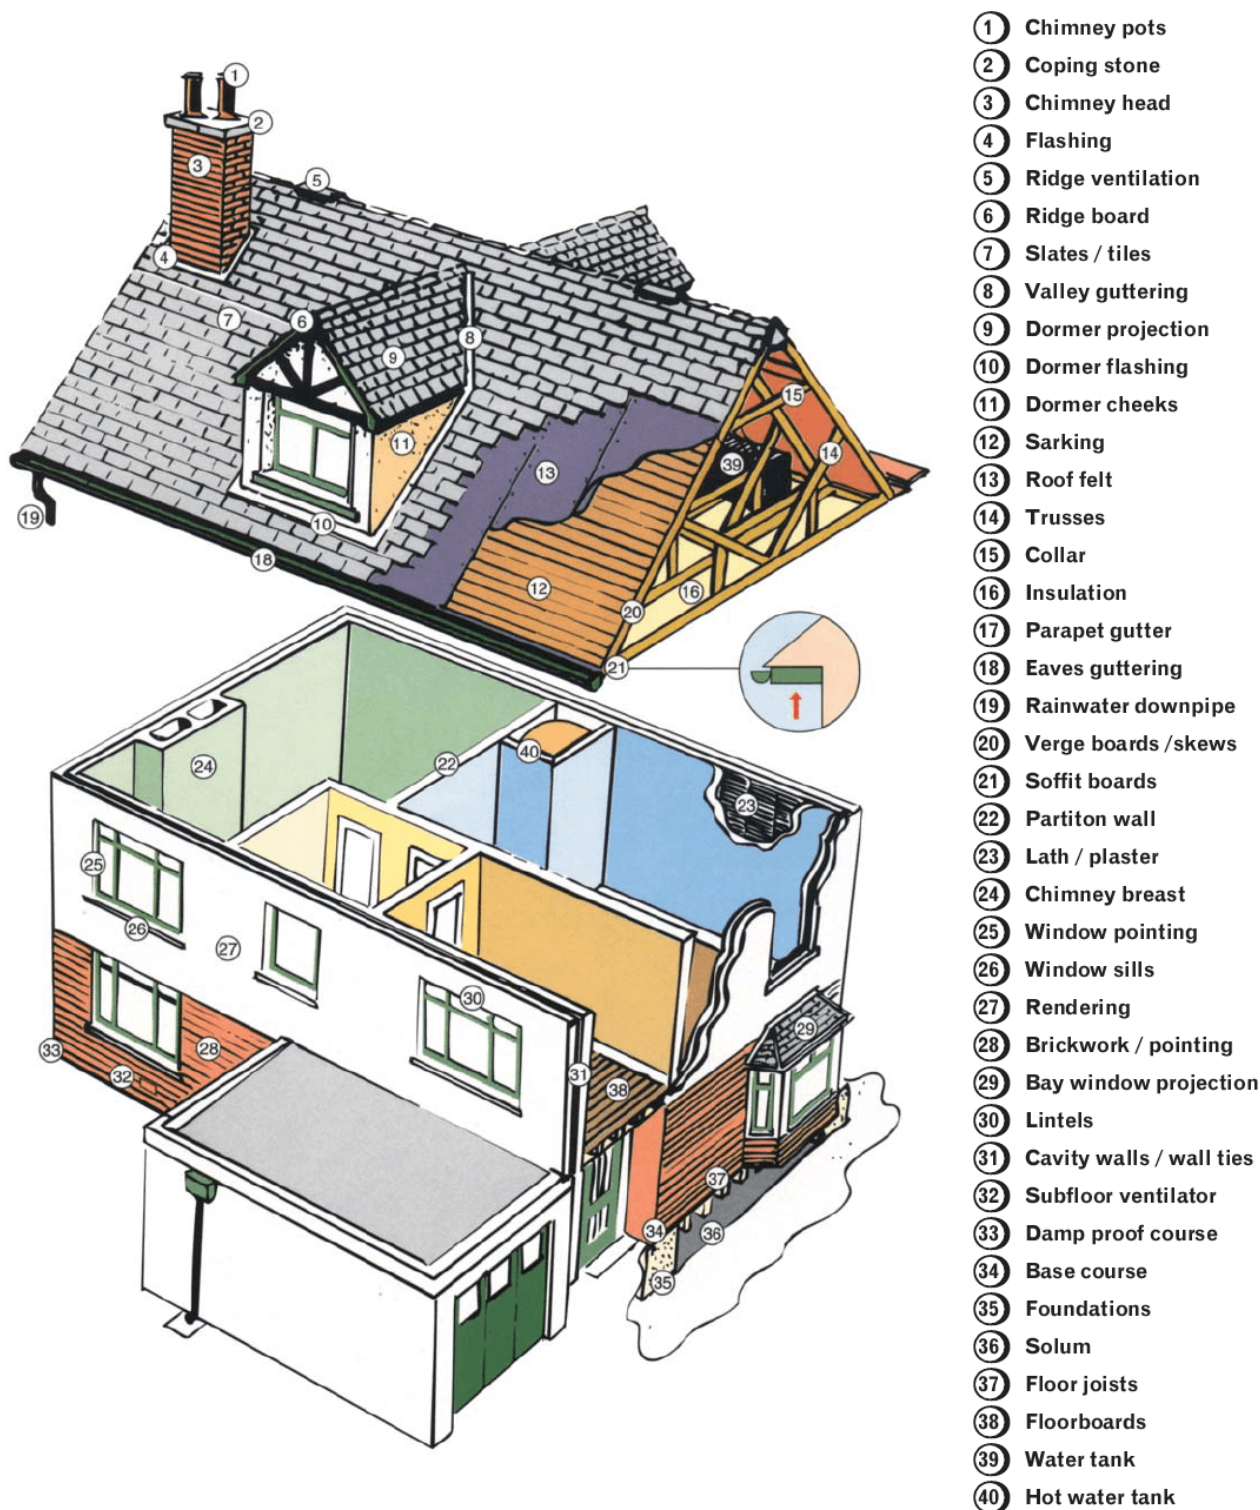

- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards /skews
- ㉑ Soffit boards
- ㉒ Partiton wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.


Structural movement	
Repair category:	1
Notes:	There is evidence of settlement/movement to the building, noted both internally and externally, but this is not inconsistent with a property of this age and type, and on the basis of a single inspection appears to be longstanding.


Dampness, rot and infestation	
Repair category:	1
Notes:	There was no evidence found of significant dampness, rot or infestation within those areas of the property available for inspection. Damp meter readings were taken at random, in accessible areas throughout the property and moisture levels were found to be within an acceptable range.


Chimney stacks	
Repair category:	
Notes:	Not applicable.

Roofing including roof space	
Repair category:	

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.


	
Notes:	<p>Typical weathering is evident to tilework, which appears along original lines and there is also an accumulation of moss growth in places. Ongoing maintenance and repairs should be anticipated. There was, however, no evidence of staining within the roof space to suggest water penetration. The level of insulation within the roof space is inadequate compared to current standards, and therefore should be improved, with adequate provision included for ventilation.</p> <p>Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectancy around 50/60 years according to the BRE. Life expectancy will, however, often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise further on life expectancy and any repair/replacement costs.</p> <p>Boarding to verges externally may contain asbestos material. Specialist advice should be obtained prior to working on these areas, or in the event of handling/removal to minimise the risk of releasing hazardous fibres.</p>


Rainwater fittings	
Repair category:	
Notes:	There was no evidence of damp staining/water staining on wall surfaces which would indicate leakage. It should be noted that it was not raining at the time of our inspection.

Main walls	
Repair category:	
	Cracking is evident to render as a result of some

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Notes:	settlement/movement, which from a single inspection appears long-standing and non-progressive. Some patching/repair works should be anticipated to these areas as part of an ongoing maintenance programme, to prevent the possibility of water ingress and prevent any further deterioration.
--------	--

Windows, external doors and joinery	
Repair category:	
Notes:	<p>The windows functioned adequately where tested. They are, however, of mixed age, with the most recent replacement units being installed in 2009. Typical wear is evident to older units.</p> <p>The external doors functioned adequately. The front entrance door is along older/original lines, whereas the rear entrance door is along modern lines.</p> <p>Windows and external doors can be problematic and over time their operation can be affected and opening mechanisms damaged. It is therefore likely that attention will be required as part of an ongoing maintenance programme.</p>

External decorations	
Repair category:	
Notes:	The external decorations are generally in fair condition. Regular renewal will be required if these areas are to be maintained in satisfactory condition.

Conservatories / porches	
Repair category:	

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Notes:	Not applicable.
--------	-----------------

Communal areas	
Repair category:	
Notes:	Not applicable.

Garages and permanent outbuildings	
Repair category:	2
Notes:	Typical weathering is evident to the flat felt roof coverings over the garage and store. It should be appreciated that this type of roof covering has a limited life, and will require regular maintenance and eventual renewal. It is, however, understood that previous patch repairs have been carried out. A degree of staining was noted to lining boards within the garage, although this appears historic and is understood to pre-date the patch repairs. There is evidence of some differential movement between the garage and the store, reflected by cracking to render. On the basis of a single inspection, this appears to be longstanding and non-progressive, although the affected areas should be monitored, and some patching/repair works anticipated. Some deterioration/decay is evident to areas of external joinery and overhaul/replacement of the affected areas will likely be required in due course.

Outside areas and boundaries	
Repair category:	1
Notes:	The site boundaries are generally well defined and appeared in adequate condition. Regular maintenance should however be

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

	anticipated. You should verify with your conveyancer the extent of the boundaries attaching to the property.
--	--


Ceilings	
Repair category:	1
Notes:	Within the limits of our inspection, no reportable defects were evident.

Internal walls	
Repair category:	1
Notes:	Within the limits of our inspection, no reportable defects were evident.


Floors including sub-floors	
Repair category:	1
Notes:	<p>The flooring was found to be generally level and firm to the tread, with the exception of some loose/creaking panels, which is considered to be cosmetic in nature.</p> <p>No access to the sub-floor chamber was possible. Within the limitations of our inspection, there was no indication to suggest significant defects in this area. It will, however, be appreciated that as the area was not inspected, no guarantees can be provided in this regard.</p>

Internal joinery and kitchen fittings

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	
Notes:	<p>The internal joinery is in keeping with the age and character of the subjects. Typical wear and tear is evident to some areas. A number of door frames are slightly distorted, which is considered to be due to longstanding settlement/movement.</p> <p>The kitchen fittings are dated and worn in places. Consideration should be given to upgrading/replacement.</p>


Chimney breasts and fireplaces	
Repair category:	
Notes:	Not applicable.


Internal decorations	
Repair category:	
Notes:	The subjects were found to be in fair decorative condition.


Cellars	
Repair category:	
Notes:	Not applicable.

Electricity

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	
Notes:	<p>The electrical system includes a dated fuse box. There are also limited/inadequate power outlet facilities to some areas. It will be necessary to have the system checked and upgraded by a qualified electrician.</p> <p>The institution of Engineering and Technology recommends that inspections and testing are undertaken at least every 10 years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which will fully comply with IET regulations.</p>

Gas	
Repair category:	
Notes:	In the interests of safety, all gas appliances should be checked by a Gas Safe registered tradesman.

Water, plumbing and bathroom fittings	
Repair category:	
Notes:	<p>Pipework (where seen) was noted to be of copper/PVC and appeared in a serviceable condition, but was not tested.</p> <p>The sanitary fittings are dated and worn in places. Consideration should be given to upgrading/replacement.</p> <p>Flooring beneath the bath was not inspected, however it should be appreciated that over time the build-up of condensation together with small amounts of leakage from joints between tiling or mastic and bath/shower fittings can lead to deterioration of flooring or wall linings. Repairs in this regard may be required as part of a normal and ongoing maintenance regime.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and hot water	
Repair category:	1
Notes:	The boiler is along modern lies and has been regularly serviced since its installation as a condition of the guarantee. It is understood that the guarantee expires in October 2023. The system will still require ongoing/regular servicing. The radiators are along older lines, although within the limits of our visual inspection, no reportable defects were evident.

Drainage	
Repair category:	1
Notes:	There was no surface evidence to suggest the system is choked or leaking.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	
Roofing including roof space	2
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	
Internal decorations	1
Cellars	
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground and first.
2. Are there three steps or fewer to a main entrance door of the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
<p>We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.</p> <p>Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.</p> <p>We noted no evidence of significant structural alterations, recent or otherwise having been carried out to the subjects.</p> <p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p>	
Estimated re-instatement cost (£) for insurance purposes	
<p>250,000 Two Hundred and Fifty Thousand Pounds.</p>	
Valuation (£) and market comments	
<p>240,000 Two Hundred and Forty Thousand Pounds</p>	
Report author:	Mark Smith, Bsc MRICS
Company name:	St Andrews - Allied Surveyors Scotland Plc
Address:	1-3 St Leonard's Lodge Abbey Walk St Andrews KY16 9LB
Signed:	Electronically Signed: 247870-9b72761b-52c6
Date of report:	22/12/2023

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	26 Bow Butts Crail, Anstruther KY10 3UR	Client: Mrs. Karen Reekie Tenure: Outright Ownership
Date of Inspection:	22/12/2023	Reference: J3764

This report has been prepared as part of your instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising your lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The subjects form part of a private residential development on the north western periphery of Crail. The immediate surrounding properties are of similar age and construction. There are open aspect views to the rear, over a park/playing field. Adequate secondary shopping, educational, public transport and social facilities are available locally.

2.0 DESCRIPTION

2.1 Age:

Built around 1970/1975.

The subjects comprise a two storey detached house.

3.0 CONSTRUCTION

The main walls are of cavity concrete block/brick construction, rendered externally. The roof is pitched and laid in tiles on a timber structure.

4.0 ACCOMMODATION

GROUND FLOOR
Entrance Hall, Lounge/Dining Area and Kitchen.

FIRST FLOOR
Landing, Three Bedrooms and Bathroom with WC.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:	Mains
---------------	-------	---------------------	-------	-------------	-------	------------------	-------

Central Heating:	Gas fired boiler to radiators.
-------------------------	--------------------------------

6.0	OUTBUILDINGS				
Garage:	Attached garage of brick wall construction, rendered externally, with the roof being flat and laid in mineral felt.				
Others:	Attached to the rear of the garage is a store of concrete block wall construction, rendered externally, with the roof being flat and laid in mineral felt.				
7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>				
<p>At the time of inspection, the subjects were generally found to be in a fair condition, although some works of repair and maintenance are required. Some elements are also ageing and are likely to require attention and/or upgrading/replacement in due course.</p> <p>We have reflected the condition of the subjects in our valuation.</p> <p>There is evidence of settlement/movement to the building, noted both internally and externally, but this is not inconsistent with a property of this age and type, and on the basis of a single inspection appears to be longstanding.</p>					
8.0	ESSENTIAL REPAIR WORK <i>(as a condition of any mortgage or, to preserve the condition of the property)</i>				
None.					
8.1 Retention recommended:					
9.0	ROADS & FOOTPATHS				
The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.					
10.0	BUILDINGS INSURANCE (£):	250,000	GROSS EXTERNAL FLOOR AREA	101 m2	Square metres
<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>					
11.0	GENERAL REMARKS				
<p>We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.</p> <p>Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.</p> <p>We noted no evidence of significant structural alterations, recent or otherwise having been carried out to the subjects.</p> <p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p>					
12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if</i>				

	<i>they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>		
12.1	Market Value in present condition (£):	240,000	Two Hundred and Forty Thousand Pounds
12.2	Market Value on completion of essential works (£):		
12.3	Suitable security for normal mortgage purposes?	Yes	
12.4	Date of Valuation:	22/12/2023	
Signature:		Electronically Signed: 247870-9b72761b-52c6	
Surveyor:	Mark Smith	Bsc MRICS	Date: 22/12/2023
St Andrews - Allied Surveyors Scotland Plc			
Office:	1-3 St Leonard's Lodge Abbey Walk St Andrews KY16 9LB	Tel: 01334 800 008 Fax: email: standrews@alliedsurveyorsscotland.com , brenda.lawrie@alliedsurveyorsscotland.com	

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	26 Bow Butts Crail, Anstruther KY10 3UR
-------------------------	---

Customer	Mrs. Karen Reekie
-----------------	-------------------

Customer address	26 Bow Butts Crail, Anstruther KY10 3UR
-------------------------	---

Prepared by	Mark Smith, Bsc MRICS St Andrews - Allied Surveyors Scotland Plc
--------------------	---

Energy Performance Certificate (EPC)

Scotland

Dwellings

26 BOW BUTTS, CRAIL, ANSTRUTHER, KY10 3UR

Dwelling type: Detached house
Date of assessment: 05 September 2023
Date of certificate: 05 September 2023
Total floor area: 88 m²
Primary Energy Indicator: 312 kWh/m²/year


Reference number: 0356-1011-6201-2407-8200
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£7,419	See your recommendations report for more information
Over 3 years you could save*	£2,613	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

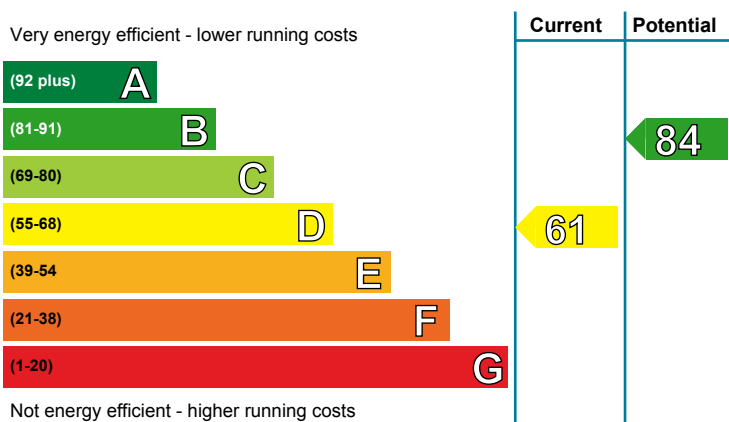


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (61)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

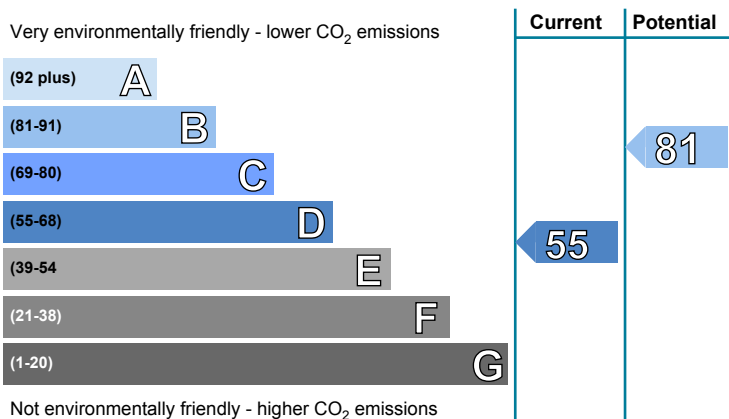

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (55)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Increase loft insulation to 270 mm	£100 - £350	£327.00
2 Cavity wall insulation	£500 - £1,500	£1290.00
3 Floor insulation (suspended floor)	£800 - £1,200	£564.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 50 mm loft insulation	★★☆☆☆	★★☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in 75% of fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 55 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.8 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.7 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.













Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£5,943 over 3 years	£3,792 over 3 years	
Hot water	£963 over 3 years	£603 over 3 years	
Lighting	£513 over 3 years	£411 over 3 years	
Totals	£7,419	£4,806	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Increase loft insulation to 270 mm	£100 - £350	£109		
2 Cavity wall insulation	£500 - £1,500	£430		
3 Floor insulation (suspended floor)	£800 - £1,200	£188		
4 Low energy lighting for all fixed outlets	£10	£29		
5 Solar water heating	£4,000 - £6,000	£113		
6 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£668		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

5 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	16,113	(972)	(3,819)	N/A
Water heating (kWh per year)	2,714			

Addendum

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Mark Smith
Assessor membership number:	EES/009457
Company name/trading name:	Allied Surveyors Scotland Plc
Address:	18a Dickson Street Dunfermline KY12 7SL
Phone number:	01383 738 585
Email address:	dunfermline@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

26 Bow Butts
Crail, Anstruther
KY10 3UR

Seller(s)

Mr C Reekie & Mrs K Reekie

Completion date of property questionnaire

05/09/2023

Note for sellers

1.	Length of ownership
	How long have you owned the property? 43 years
2.	Council tax
	Which Council Tax band is your property in? (Please circle) []A []B []C []D [x]E []F []G []H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply)
	Garage [x]
	Allocated parking space []
	Driveway [x]
	Shared parking []
	On street []
	Resident permit []
	Metered parking []
	Other (please specify):

Conservation area

4.		
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	[]YES [x]NO []Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	[]YES [x]NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	[]YES [x]NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	[]YES []NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	[x]YES []NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	[x]YES []NO
	(ii) Did this work involve any changes to the window or door openings?	[]YES [x]NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	

7.	Central heating	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Partial
	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <i>Gas-fired</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? <i>When the house was built</i>	
	(ii) Do you have a maintenance contract for the central heating system?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract <i>Scottish Gas</i>	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year). <i>March 2023</i>	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<input type="checkbox"/> YES <input type="checkbox"/> NO
b	Are you aware of the existence of asbestos in your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
	Services	

10.			
a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	Y	Scottish Gas
	Water mains or private water supply	Y	Scottish Water
	Electricity	Y	Scottish Power
	Mains drainage	Y	Scottish Water
	Telephone	Y	BT
	Cable TV or satellite	N	
	Broadband	N	
b	Is there a septic tank system at your property?	[] YES [x] NO	
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?	[] YES [] NO [] Don't know	
	(ii) Do you have a maintenance contract for your septic tank?	[] YES [] NO	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
11.	Responsibilities for shared or common areas		
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	[] YES [x] NO [] Don't know	
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	[] YES [x] NO [] N/A	
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	[] YES [x] NO	
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries?	[] YES [x] NO	

	If you have answered yes, please give details:	
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	[]YES [x]NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	[]YES [x]NO
12.	Charges associated with your property	
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	[]YES [x]NO
b	Is there a common buildings insurance policy?	[]YES [x]NO []Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[]YES []NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or	

	estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	
--	---	--

14.	Guarantees	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
16.	Notices that affect your property	
	In the past three years have you ever received a notice:	

property questionnaire

a	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	that affects your property in some other way?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.	
Signature(s):	Karen Reekie
Capacity:	<input checked="" type="checkbox"/> Owner <input type="checkbox"/> Legally Appointed Agent for Owner
Date:	05/09/2023