

YOUR ONESURVEY HOME REPORT

ADDRESS

9 Canongate
St. Andrews
KY16 8RT

PREPARED FOR

The Client of Lawrie Estate Agents

INSPECTION CARRIED OUT BY:



SELLING AGENT:



HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	St Andrews - Allied Surveyors Scotland Ltd	05/08/2026
Mortgage Certificate	Final	St Andrews - Allied Surveyors Scotland Ltd	05/08/2026
Property Questionnaire	Final	The Client of Lawrie Estate Agents	06/08/2026
EPC	Final	St Andrews - Allied Surveyors Scotland Ltd	05/08/2026

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories
being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	J5560
---------------------------	-------

Customer	The Client of Lawrie Estate Agents
-----------------	------------------------------------

Selling address	9 Canongate St. Andrews KY16 8RT
------------------------	--

Date of Inspection	04/08/2026
---------------------------	------------

Prepared by	Nigel Forrest, MRICS St Andrews - Allied Surveyors Scotland Ltd
--------------------	--

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a detached two storey villa with garden ground, garage and store sheds.
Accommodation	GROUND FLOOR: Entrance Vestibule, Main Hall, Living Room, Dining Room, Kitchen, Toilet and Conservatory. FIRST FLOOR: Three Bedrooms and Bathroom.
Gross internal floor area (m2)	140m2 (including conservatory) or thereby.
Neighbourhood and location	The subjects are located on the South most side of St Andrews, where surrounding properties are of similar character to that under report. Essential facilities/amenities are available in the town.
Age	Built 1964.
Weather	The weather was fair and dry at the time of inspection.
Chimney stacks	The chimney stacks are of roughcast brick with metal flashings and clay pots. Visually inspected with the aid of binoculars where required.

Roofing including roof space	The roof is timber framed, pitched and tiled with Photovoltaic Panels fitted. Access to the roof space was gained via a trap hatch formed in the landing ceiling. A pull down ladder and light was provided, and the roof space is partly floored and there was insulation between the joists. Sloping roofs were visually inspected with the aid of binoculars where required. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
Rainwater fittings	Rainwater fittings are of cast iron and painted. Visually inspected with the aid of binoculars where required.
Main walls	The main walls are of cavity brick, roughcasted with the benefit of cavity wall insulation between installed. Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.
Windows, external doors and joinery	The front and rear doors are of PVC. Windows are fitted with PVC double glazed units. PVC fascias and soffit fitted. Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open.
External decorations	The various external components are mainly of low maintenance PVC. Visually inspected.
Conservatories / porches	PVC conservatory under a polycarbonate roof. Visually inspected.
Communal areas	Not applicable.
Garages and permanent outbuildings	There is a detached single garage of roughcast brick under a cement asbestos corrugated roof, with up and over door and timber pedestrian door. There is also a portacabin and timber shed. Visually inspected.

Outside areas and boundaries	The subjects enjoy an area of garden ground to the front and rear of the property, with boundaries being of blockwall, part timber fencing. Visually inspected.
Ceilings	Ceilings are of plasterboard throughout. Visually inspected from floor level.
Internal walls	Internal walls are mainly of plastered on the hard, with some finishes being tiled/wet wall materials. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
Floors including sub floors	Flooring is of suspended timber construction, overlaid with fitted floor coverings. No inspection was possible to any sub-floor area. Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
Internal joinery and kitchen fittings	Doors, facings and skirtings are in keeping with a property of this age and type. Kitchen fittings have units and work surfaces. Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances.
Chimney breasts and fireplaces	There is a gas fire with back boiler (Baxi Bermuda) in the living room. Visually inspected. No testing of the flues or fittings was carried out.
Internal decorations	Walls and ceilings are a mixture of paper and paint. Joinery has a paint/varnish/stain finish. Visually inspected.
Cellars	Not applicable.

Electricity	Mains supply, with the meter and fusebox located in a hall cupboard. There is also a meter for the Photovoltaic Panels. Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.
Gas	Mains supply, with the meter housed in an external box. Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.
Water, plumbing and bathroom fittings	Mains supply, with the plumbing system where seen, being of modern materials. Sanitary fittings comprise a downstairs toilet with wc and wash hand basin and a main bathroom with bath, shower cubicle, wc and wash hand basin. There is also a stainless steel sink in the kitchen. Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.
Heating and hot water	Heating and hot water is provided by a Baxi Bermuda back boiler, located in the gas fire in the living room. Heating is distributed via radiators with TRV's fitted. There is also a room thermostat in the hall. The hot water storage tank is located in a bedroom cupboard. Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.
Drainage	Drainage is connected to the main sewer. Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.

Fire, smoke and burglar alarms	Fire and smoke alarms fitted. Visually inspected No test whatsoever were carried out to any systems or appliances. There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required. The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022. We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.
Any additional limits to inspection	At time of inspection the property was fully furnished with fitted floor coverings throughout. No inspection was possible to any sub-floor area. It should be appreciated that further defects can arise after the date of our inspection. Inspection of the roof space was carried out where possible, to floored areas. External inspection was carried out from ground level, and limited sight was seen of roof coverings. An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive. Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	From our single inspection, there was no evidence of any significant structural movement affecting the property.

Dampness, rot and infestation	
Repair category:	2
Notes:	Where access was gained no sign of any dampness or rot was noted to accessible areas. There is evidence of wood boring insect infestation to the roof timbers, which would be better treated with a preservative to avoid any furtherance.

Chimney stacks	
Repair category:	1
Notes:	The chimney stack appears in an order consistent with one of its age and type, where seen from ground level.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space

Repair category:	2
Notes:	The roof is of an age where it will require above average attention to maintenance, and this should be anticipated. Clear evidence has come to light that concrete tiles can deteriorate at around 30/40 years, therefore, taking the above into consideration, as well as the age and type of roof coverings employed, future works of repair and maintenance will be anticipated. Photovoltaic Panels are fitted to the roof. There is an accumulation of moss to the roof, which can shorten the lifespan of the tiles. Within the roof space there was insulation, as well as a scattering of wood boring insect infestation.

Rainwater fittings

Repair category:	1
Notes:	The Rainwater fittings showed no sign of leakage at time of inspection, but should be monitored during adverse weather. The weather was dry at time of inspection.

Main walls

Repair category:	1
Notes:	The main walls appear adequately maintained. Cavity wall insulation has been installed, and it should be confirmed what paperwork is available.

Windows, external doors and joinery

Repair category:	1
Notes:	Windows and doors are PVC components with the windows being of mixed age.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

External decorations	
Repair category:	1
Notes:	External decoration is of low maintenance PVC.

Conservatories / porches	
Repair category:	1
Notes:	A modern conservatory has been fitted.

Communal areas	
Repair category:	
Notes:	Not applicable.

Garages and permanent outbuildings	
Repair category:	1
Notes:	The garage generally appears adequately maintained. The roof is of cement asbestos corrugated sheeting and care/attention must be taken if damage/disturbed. The portacabin appears adequately maintained.

Outside areas and boundaries	
Repair category:	1
Notes:	The garden ground is reasonably well maintained. Your Legal Advisor should confirm exact boundaries and liabilities for any shared/common areas serving the subject property.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Ceilings	
Repair category:	1
Notes:	Ceilings finishes are generally in an order consistent with age and type. There is some cracking to some of the ceilings, but this can be attended to at time of redecoration.

Internal walls	
Repair category:	1
Notes:	Internal walls finishes were found to be generally satisfactory and in an order consistent with a property of this age and type.

Floors including sub-floors	
Repair category:	1
Notes:	Where access was gained the flooring was found to be hard and free from significant defects. No inspection was possible to sub-floor areas.

Internal joinery and kitchen fittings	
Repair category:	1
Notes:	Internal joinery is generally in an order consistent with a property of this age and type. Kitchen fittings are not of the newest, but do have suitable worktop and storage space.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Chimney breasts and fireplaces

Repair category:	1
Notes:	Gas fire in the living room and this should be serviced on an annual basis. All flues should be checked prior to any use, and if not in use should be suitably capped and vented.

Internal decorations

Repair category:	1
Notes:	Decoration is reasonable, but some works may become apparent.

Cellars

Repair category:	
Notes:	Not applicable.

Electricity

Repair category:	1
Notes:	We understand the property has been re-wired in the past, and documentation should be obtained. There is also a secondary meter for the Photovoltaic Panels. The Electrical Installation should be tested every five/ten years and a Certificate produced thereafter, and transferred with the sale of the property.

Gas

Repair category:	1
Notes:	All gas appliances should be checked on an annual basis by a Gas Safe Registered Contractor.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Water, plumbing and bathroom fittings

Repair category:	1
Notes:	The plumbing system is of modern pattern and appeared to be adequate. Sanitary fittings appeared serviceable, however no tests were carried out. It is important that when baths/showers cubicles are fitted that suitable screening/sealant be maintained around the bath/tray to avoid water ingress, which can cause rot defects.

Heating and hot water

Repair category:	2
Notes:	Heating is via a back boiler, and this may be nearing the end of its life. Upgrading to a modern system may be desirable as in excess of 20 years old. It is good practice to have the system on a service contract.

Drainage

Repair category:	1
Notes:	No defects identified from surface inspection.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories / porches	1
Communal areas	
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	2
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground and First.
2. Are there three steps or fewer to a main entrance door of the property?	☒ YES ☐ NO
3. Is there a lift to the main entrance door of the property?	☐ YES ☒ NO
4. Are all door openings greater than 750mm?	☐ YES ☒ NO
5. Is there a toilet on the same level as the living room and kitchen?	☒ YES ☐ NO
6. Is there a toilet on the same level as a bedroom?	☒ YES ☐ NO
7. Are all rooms on the same level with no internal steps or stairs?	☐ YES ☒ NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	☒ YES ☐ NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
The property has been altered/extended in the past and our valuation assumes all necessary consents/approvals were obtained. Photovoltaic Panels are fitted and all documentation should be obtained in this regard. Cavity wall insulation has been installed, and it should be confirmed what paperwork is available. Your Legal Advisor should confirm exact boundaries and liabilities for any shared/common areas serving the subject property. Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchases contracts, further specialist advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property	
Estimated re-instatement cost (£) for insurance purposes	
400,000 Four Hundred Thousand Pounds.	
Valuation (£) and market comments	
440,000 Four Hundred and Forty Thousand Pounds.	
Report author:	Nigel Forrest, MRICS
Company name:	St Andrews - Allied Surveyors Scotland Ltd
Address:	1-3 St Leonard's Lodge Abbey Walk St Andrews KY16 9LB
Signed:	Electronically Signed: 314120-4a8998c8-2aac
Date of report:	05/08/2026

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.



Mortgage Valuation Report

Mortgage Valuation Report

Property:	9 Canongate St. Andrews KY16 8RT	Client: The Client of Lawrie Estate Agents Tenure: Absolute Ownership
Date of Inspection:	04/08/2026	Reference: NF/BL/J5560

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The subjects are located on the South most side of St Andrews, where surrounding properties are of similar character to that under report. Essential facilities/amenities are available in the town.

2.0 DESCRIPTION

2.1 Age:

Built 1964.

The subjects comprise a detached two storey villa with garden ground, garage and store sheds.

3.0 CONSTRUCTION

The roof is timber framed, pitched and tiled with Photovoltaic Panels fitted.

The main walls are of cavity brick, roughcasted with the benefit of cavity wall insulation between installed.

4.0 ACCOMMODATION

GROUND FLOOR: Entrance Vestibule, Main Hall, Living Room, Dining Room, Kitchen, Toilet and Conservatory.

FIRST FLOOR: Three Bedrooms and Bathroom.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:	Mains
Central Heating:	Gas fired radiator system						

6.0 OUTBUILDINGS

Garage: Single garage.

Others: Portacabin

7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>				
The property is in a condition consistent with its age and character, and any items noted during the course of the inspection, can be attended to be way of routine maintenance.					
There is evidence of wood boring insect infestation to the roof timbers and it would be prudent to have a Specialist inspect.					
The roof is of an age where it may require above average maintenance. It may be prudent to have a Roofing Contractor inspect prior to purchase.					
8.0	ESSENTIAL REPAIR WORK <i>(as a condition of any mortgage or, to preserve the condition of the property)</i>				
None					
8.1 Retention recommended:			-		
9.0	ROADS & FOOTPATHS				
Made up, assumed adopted.					
10.0	BUILDINGS INSURANCE (£):	400,000	GROSS EXTERNAL FLOOR AREA	160m2	Square metres
	<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>				
11.0	GENERAL REMARKS				
The property has been altered/extended in the past and our valuation assumes all necessary consents/approvals were obtained.					
Photovoltaic Panels are fitted and all documentation should be obtained in this regard.					
Cavity wall insulation has been installed, and it should be confirmed what paperwork is available.					
Your Legal Advisor should confirm exact boundaries and liabilities for any shared/common areas serving the subject property.					
Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchases contracts, further specialist advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property					
12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>				
12.1	Market Value in present condition (£):	440,000	Four Hundred and Forty Thousand Pounds.		

12.2	Market Value on completion of essential works (£):		
12.3	Suitable security for normal mortgage purposes?	Yes	
12.4	Date of Valuation:	04/08/2026	
Signature:		Electronically Signed: 314120-4a8998c8-2aac	
Surveyor:	Nigel Forrest	MRICS	Date: 05/08/2026
St Andrews - Allied Surveyors Scotland Ltd			
Office:	1-3 St Leonard's Lodge Abbey Walk St Andrews KY16 9LB	Tel: 01334 800 008 Fax: email: standrews@alliedsurveyorsscotland.com , brenda.lawrie@alliedsurveyorsscotland.com	

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	9 Canongate St. Andrews KY16 8RT
-------------------------	--

Customer	The Client of Lawrie Estate Agents
-----------------	------------------------------------

Customer address	9 Canongate St. Andrews KY16 8RT
-------------------------	--

Prepared by	Nigel Forrest, MRICS St Andrews - Allied Surveyors Scotland Ltd
--------------------	--

Energy Performance Certificate (EPC)

Scotland

Dwellings

9 CANONGATE, ST ANDREWS, KY16 8RT

Dwelling type: Detached house
Date of assessment: 04 August 2026
Date of certificate: 04 August 2026
Total floor area: 120 m²
Primary Energy Indicator: 273 kWh/m²/year


Reference number: 9416-8228-1000-0434-1206
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£7,626	See your recommendations report for more information
Over 3 years you could save*	£2,628	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

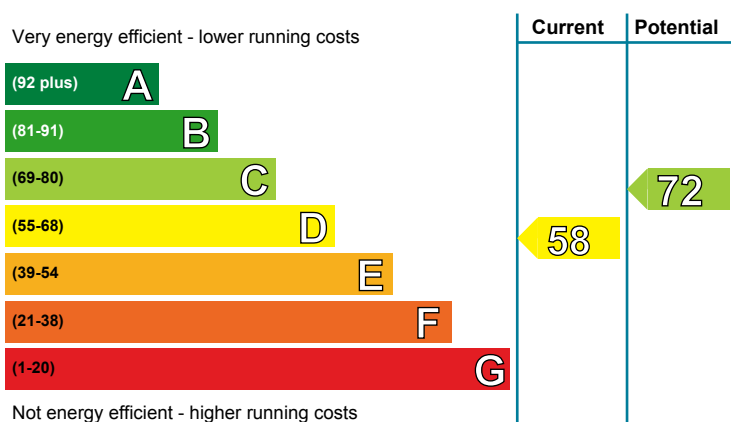


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (58)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

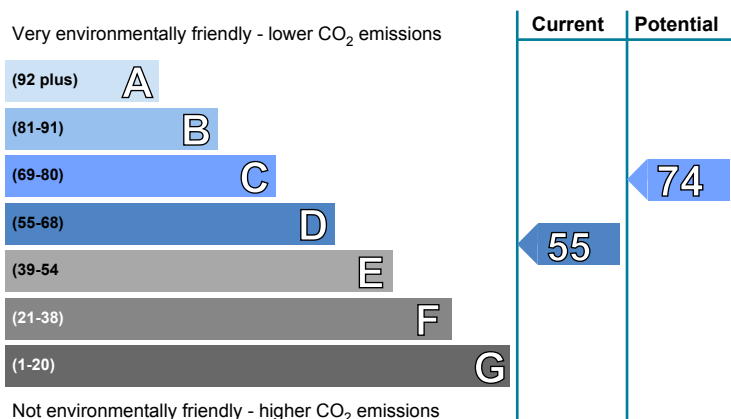

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (55)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (suspended floor)	£5,000 - £10,000	£678.00
2 Hot water cylinder thermostat	£130 - £180	£588.00
3 Condensing boiler	£2,200 - £3,500	£1362.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, filled cavity	★★★★☆	★★★★☆
Roof	Pitched, 270 mm loft insulation	★★★★★	★★★★★
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system, no cylinder thermostat	★★☆☆☆	★★☆☆☆
Lighting	Good lighting efficiency	★★★★☆	★★★★☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 51 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 6.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£5,763 over 3 years	£3,723 over 3 years	
Hot water	£1,662 over 3 years	£1,074 over 3 years	
Lighting	£201 over 3 years	£201 over 3 years	
Totals	£7,626	£4,998	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Floor insulation (suspended floor)	£5,000 - £10,000	£226		
2 Hot water cylinder thermostat	£130 - £180	£196		
3 Replace boiler with new condensing boiler	£2,200 - £3,500	£454		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Micro CHP

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Cylinder thermostat

A hot water cylinder thermostat enables the boiler to switch off when the water in the cylinder reaches the required temperature; this minimises the amount of energy that is used and lowers fuel bills. The thermostat is a temperature sensor that sends a signal to the boiler when the required temperature is reached. To be fully effective it needs to be sited in the correct position and hard wired in place, so it should be installed by a competent plumber or heating engineer. Building regulations apply to this work, so it is best to check with your local authority building standards department whether a building warrant will be required.

3 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

- Solar photovoltaics

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	14,842.69	N/A	N/A	N/A
Water heating (kWh per year)	3,564.03			

Addendum

The assessment does not include any feed-in tariffs that may be applicable to this property.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Nigel Forrest
Assessor membership number:	EES/019942
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	St Leonards Lodge Abbey Walk St Andrews KY16 9LB
Phone number:	01334 800008
Email address:	nigel.forrest@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.





EmAjine Architecture Ltd
9 Oakwood Avenue
Paisley
United Kingdom
PA2 9NG

**Economy, Planning and
Employability Services**

John Snaddon
BuildingWarrants@Fife.gov.uk
fifedirect.org.uk/buildingstandards

Your Ref:
Our Ref: 19/01131/BW

Date 29th November 2019

Dear Sir/Madam

Building (Scotland) Act 2003

Address: 9 Canongate St Andrews Fife KY16 8RT

Description: Alterations to Dwellinghouse to install new patio doors

Your building warrant application has been approved. Please read the information below regarding your approved documents.

- Compliance Plan (attached) – this plan lets you know the key stages when you need to contact us
- Building Warrant (attached) – this is a legal document that should be retained by the building owner
- Approved drawings (available to download within 7 days) – these documents should be retained by the building owner. You must contact us before making any changes to the work shown on the approved drawings.
- You must notify us within seven days of the work starting. You can do this and submit your completion certificate online at www.eBuildingStandards.scot
- For developments that include new properties, please contact the street naming and numbering team for the official address information at www.fife.gov.uk/addressing

If you require any further information please visit our web site at www.fifedirect.org.uk/buildingstandards or email us at bss.info@fife.gov.uk.

Yours faithfully

A handwritten signature in black ink, appearing to read "John Snaddon".

Building Standards & Public Safety
Economy, Planning and Employability Services
Fife House, North Street, Glenrothes, KY7 5LT
03451 55 11 22



John Snaddon
Building Standards Surveyor

BUILDING WARRANT



BUILDING (SCOTLAND) ACT 2003

Warrant under section 9 for work subject to building regulations

Grant of warrant

This warrant is granted by Fife Council in connection with the application by Mr W MacMillan dated 13th May 2019 for the Alterations to Dwellinghouse to install new patio doors

at: 9 Canongate St Andrews Fife KY16 8RT

Reference number

The reference number of the warrant is : 19/01131/BW

The following conditions apply:

that the work will be carried out as described in the building warrant and in accordance with building regulations and that nothing in any drawing, specification or other information submitted with the application indicates that the building when constructed will fail to comply with the building regulations

A copy of the agreed plans is returned

Signed –

A handwritten signature in black ink, appearing to read 'Neil Mitchell'.

For Fife Council

Dated – 29th November 2019

Sent To:

Mr W MacMillan
C/O EmAjine Architecture Ltd
9 Oakwood Avenue
Paisley
United Kingdom
PA2 9NG

Notes

1. to be considered as a limited-life building expiry must not be more than 5 years from the relevant date, which is the date of notification of acceptance of the completion certificate for the work, or the date of any permission for the temporary occupation or use of the building before acceptance of the completion certificate.
2. for construction, the stages specified in the procedure regulations are –
 - a) construction of foundations, or
 - b) such other stages as the verifiers considers appropriate having regard to any guidance issued by the Scottish Ministers
3. for demolition, the stages specified in the procedure regulations are –
 - a) isolation and removal of services, fixtures and fittings,
 - b) isolation and protection of adjacent structures, or
 - c) such other stages, appropriate to the method of demolition, as the verifier considers appropriate having regard to any guidance issued by the Scottish Ministers.
4. The verifier must be notified
 - A of the date on which work is commenced within 7 days of such,
 - B when any drain has been laid and is ready for inspection or test (unless this work is covered by a certificate of construction),
 - C when a drain track has been in-filled and the drainage system is ready for a second inspection or test (unless this work is covered by a certificate of construction),of the date on which the work is completed (unless a completion certificate is submitted in place of a notice),
 - D of the date of completion of such other stages as the verifier may require, and
 - E of the intention to use an approved certifier of construction.

A above must be notification in writing. Other notifications are at the verifier's discretion

5. It should be noted that where the owner is not the applicant, then the verifier will notify the owner of the grant of the building warrant as is required in terms of section 9 (7)(b) of the Building (Scotland) Act 2003.

Important notice

This building warrant is valid for 3 years. A Completion Certificate must be submitted when the work is complete. If a completion certificate is not submitted within that period an extension of building warrant must be obtained before the expiry date.

WARNING

A building warrant does not exempt you from obtaining other types of permission that may be necessary, such as planning permission or listed building consent. Consult the local authority if in doubt.

It is an offence to use or occupy the building(s) before obtaining acceptance of a completion certificate, unless the work is alteration only. Permission for temporary occupation may be requested from the verifier.

